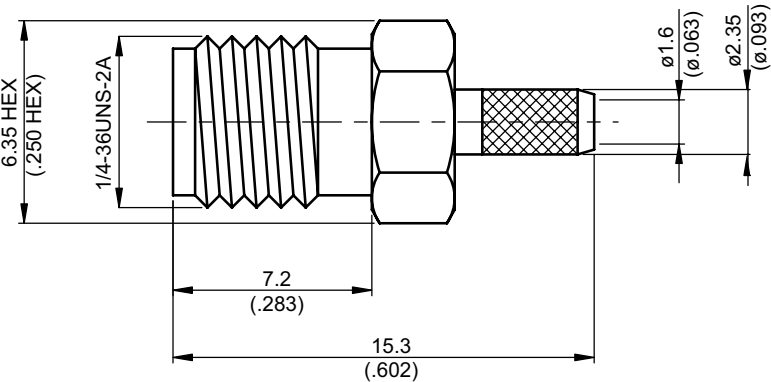


SMA8100-0316	SMA Jack Crimp	50Ω															
																	
<table border="1"> <thead> <tr> <th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr> </thead> <tbody> <tr> <td>Ferrule</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr> <tr> <td>Contact Pin</td><td>Beryllium Copper</td><td>Gold 20 Over Nickel 50 Over Copper 50</td></tr> <tr> <td>Insulator</td><td>Teflon</td><td></td></tr> <tr> <td>Body</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50	Contact Pin	Beryllium Copper	Gold 20 Over Nickel 50 Over Copper 50	Insulator	Teflon		Body	Brass	Gold 5 Over Nickel 50 Over Copper 50
Parts	Material	Plating (Micro-inch)															
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50															
Contact Pin	Beryllium Copper	Gold 20 Over Nickel 50 Over Copper 50															
Insulator	Teflon																
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50															
Weight: 1.98 g Suitable Cables: RG174, RG188, RG316, RG316-FEP, RG316-E																	

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA8100-0316

JYE BAO CO., LTD.

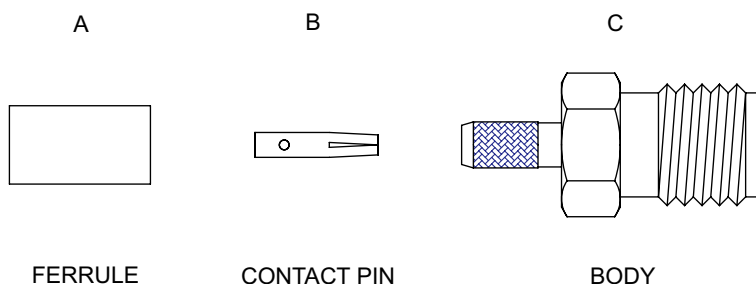


DIAGRAM	ASSEMBLY INSTRUCTION
	<p>Step 1: STRIP AS SHOWN.</p>
	<p>Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y".</p>
	<p>Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "C" IN PLACE.</p>
	<p>Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "C" AND CRIMP.</p>

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.