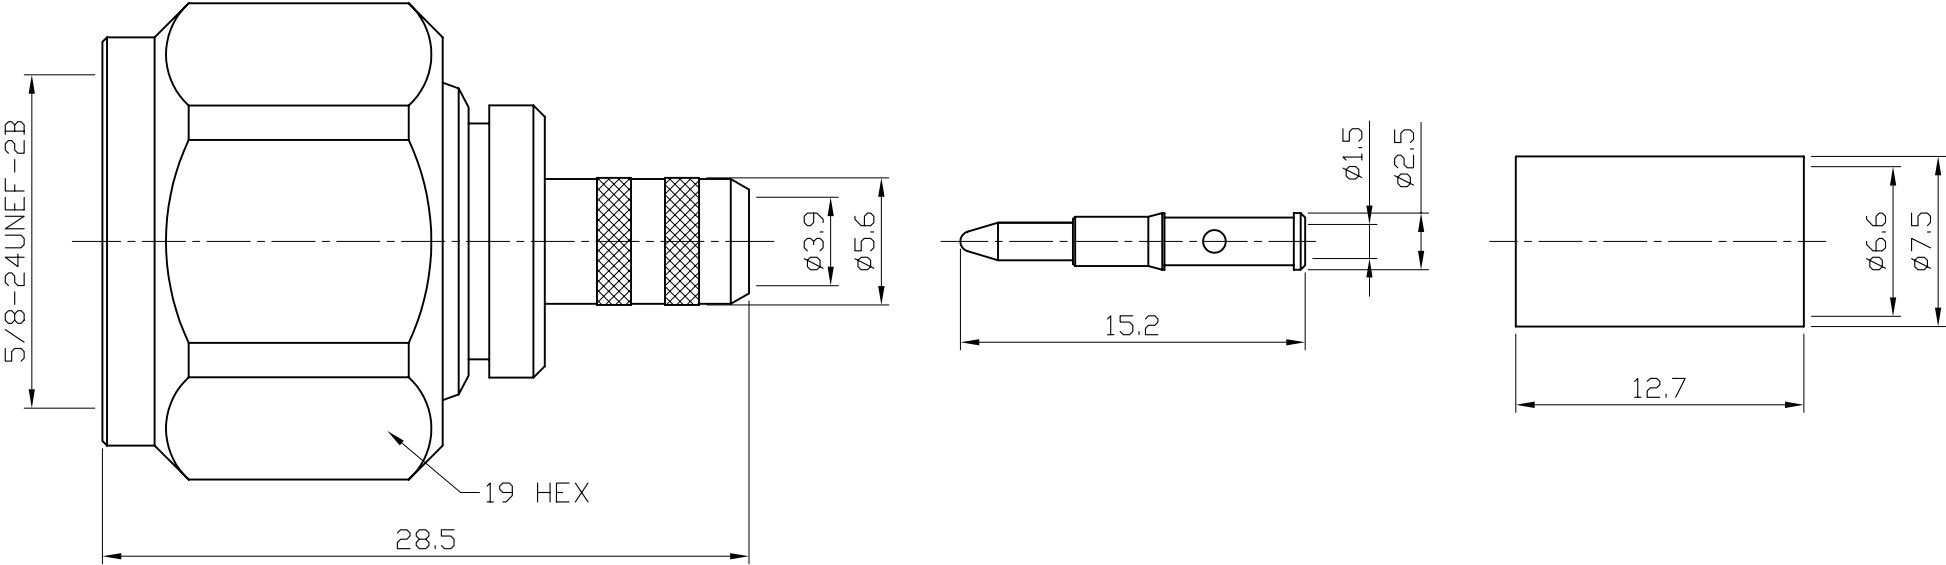


REVISION			
REV.	DESCRIPTON	DATE	APPROVED
-	INITIAL RELEASE	2013/05/20	



NOTES: FINISH (PLATING THICKNESS IN MICRO-INCHES)

1. BRASS.
2. TIN-ZINC-COPPER-ALLOY PL. 100 MIN.
OVER COPPER PL. 50 MIN.
3. GOLD PL. 4 MIN. OVER NICKEL-PHOSPHORUS ALLOY
PL. 80 MIN. OVER COPPER PL. 20 MIN.

※注意滾包零件1時不可太緊或往後掉出,要能順暢旋轉即可!!

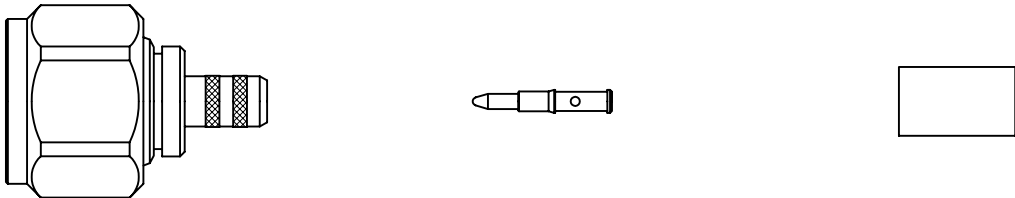
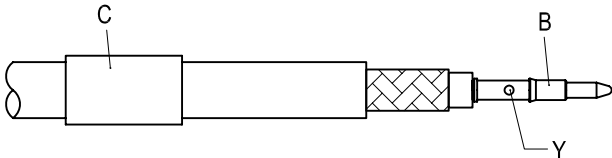
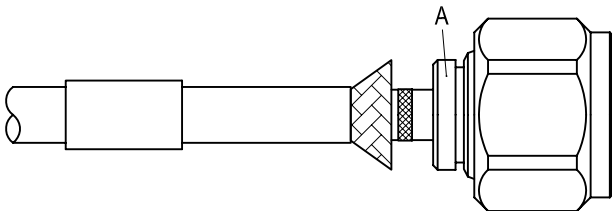
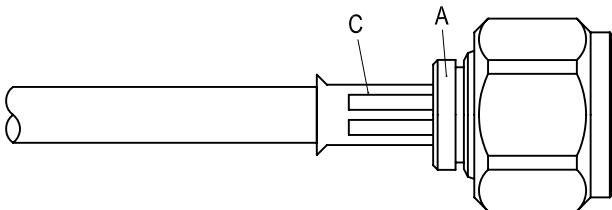
PL: 30 MIN.; OVER COOPER PL: 20 MIN.						DIMENSION ARE MILLIMETERS	SCALE	REV	UNIT	JYE BAO CO., LTD. TAIPEI TAIWAN	
6	FERRULE	COPPER	NOTE 2	1	BNC3100-0059-9/W	UNLESS OTHERWISE SPECIFIED TOLERANCES 0 ~ 5 = ±0.05 5 ~10 = ±0.07 10~20 = ±0.10 20~30 = ±0.15 30~ = ±0.20	3 / 1	-	MM		
5	GASKET	SILICONE		1	N3100-9058-6		APPROVED				DATE
4	CONTACT PIN	NOTE 1	NOTE 3	1	N3100B-L240-4/NM		CHECKED				TITLE
3	INSULATOR	TEFLON		1	N3100B-L200-3		DATE			N PLUG CRIMP	
2	BODY	NOTE 1	NOTE 2	1	N3100B-L240-2/W		DRAWING			DRAWING NO.	
1	SHELL	NOTE 1	NOTE 2	1	N3100BA-1/W				DATE	N3100BA-L240	
NO.	DESCRIPTION	MATERIAL	FINISH	Q'TY	PART NO.						

UNLESS OTHERWISE SPECIFIED
TOLERANCES

0 ~ 5 = ±0.05
5 ~10 = ±0.07
10~20 = ±0.10
20~30 = ±0.15
30~ = ±0.20

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

N3100BA-L240		DATE	2014/04/29	REV	—
A B C  BODYCONTACT PINFERRULE					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-E IF CRIMPED)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 6.5mm/0.256inch HEX SECTION OF INSERT-E)		
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	