


N3200BA-0218

N Plug Clamp

50Ω

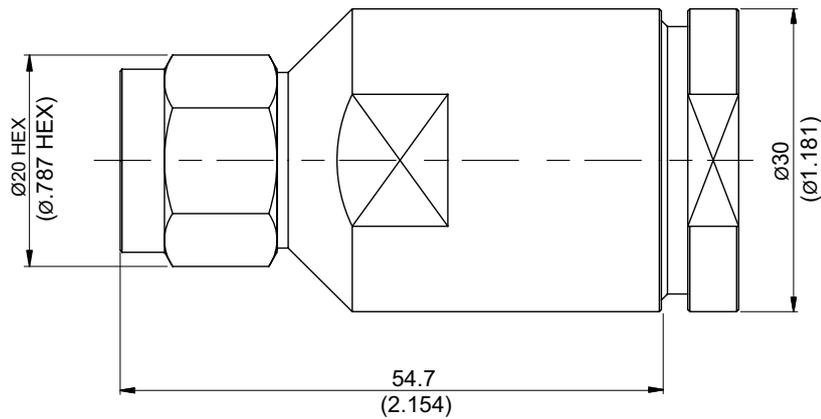

Parts	Material	Plating (Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:
Suitable Cables: RG218


This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION


N3200BA-0218

JYE BAO CO., LTD.

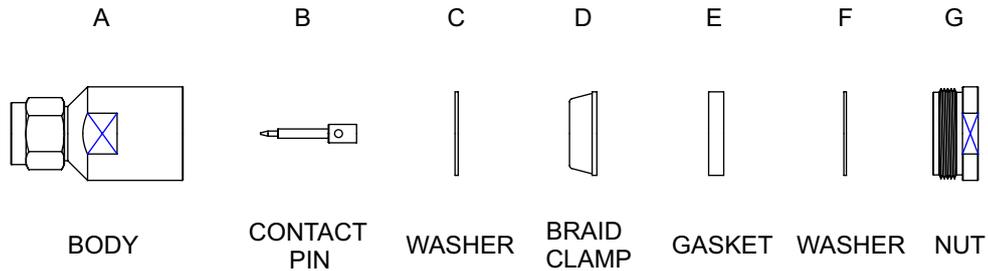


DIAGRAM


ASSEMBLY INSTRUCTION

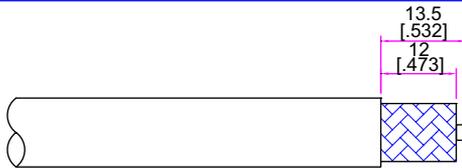


Step 1: STRIP AS SHOWN .

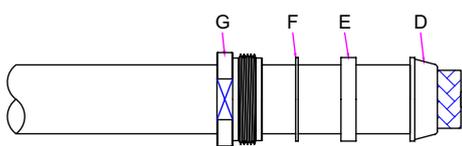


Step 2: SLIDE " D " " E " " F " " G " OVER CABLE.

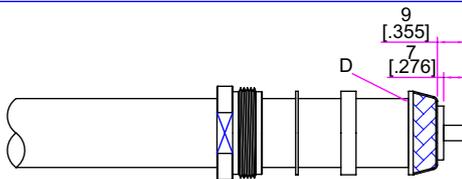

Step 3: WRAP THE BRAIDING OVER " D ".
Step 4: STRIP THE DIELECTRIC AS SHOWN.

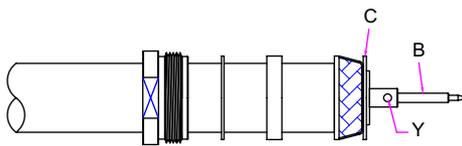

Step 5: PUT WASHER " C " AND PIN " B " ON CENTER CONDUCTOR .
SOLDER IN "Y".

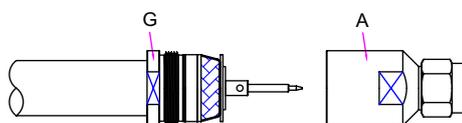

Step 6: FINALLY SCREW " G " ON THE CONNECTOR BODY " A ".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.