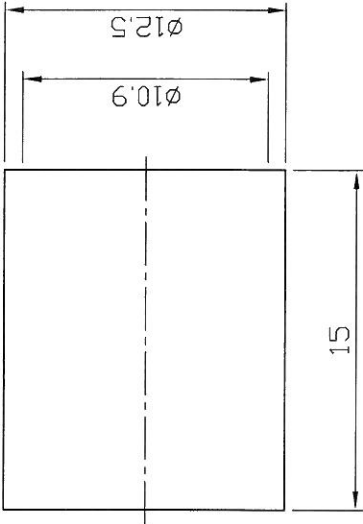
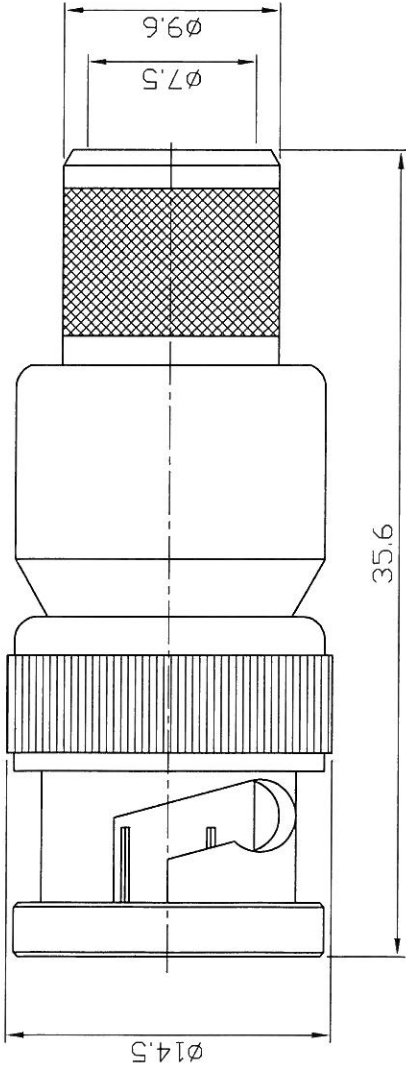


REVISION			
ASS. CON. REV.	DESCRIPTION	DATE	APPROVED
-	INITIAL RELEASE	2015/12/04	



NOTES: FINISH (PLATING THICKNESS IN MICRO-INCHES)

1. BRASS.
2. TIN-ZINC-COPPER-ALLOY PL. 100 MIN.
OVER COPPER PL. 50 MIN.
3. GOLD PL. 4 MIN. OVER NICKEL-PHOSPHORUS ALLOY
PL. 80 MIN. OVER COPPER PL. 20 MIN.

NO.	DESCRIPTION	MATERIAL	FINISH	Q'TY	PART NO.	REV.
11	FERRULE	COPPER	NOTE 2	1	N3100-0213-8/W	E
10	GASKET	SILICONE		1	BNC3100-7	A
9	WASHER	NOTE 1	NOTE 2	1	BNC3100-6/W	C
8	SPRING	SK 5	NOTE 2	1	BNC3100-5/W	B
7	WASHER	NOTE 1	NOTE 2	1	BNC3100-4/W	B
6	FERRULE	NOTE 1	NOTE 2	1	BNC3175-L400-6/W	-
5	CONTACT PIN	NOTE 1	NOTE 3	1	BNC3175-L400-5/NM	-
4	BARREL	NOTE 1	NOTE 2	1	BNC3100-0213-4/W	D
3	INSULATOR	TEFLON		1	BNC3100-R011-3	-
2	BODY	NOTE 1	NOTE 2	1	BNC3100-0213-2/W	A
1	SHELL	NOTE 1	NOTE 2	1	BNC3100-1/W	D



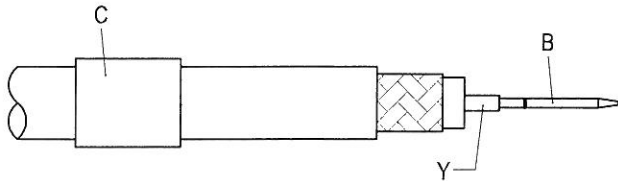
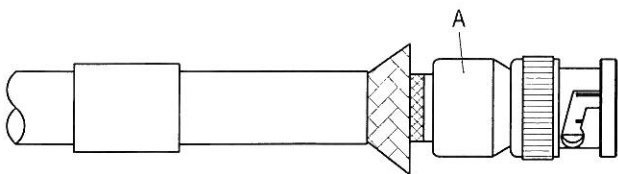
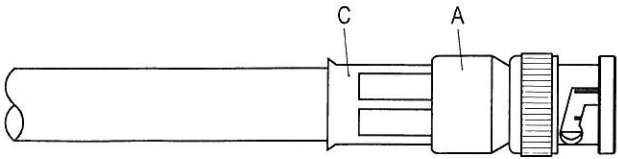
JYE BAO CO., LTD.			
TAIPEI TAIWAN			
BNC PLUG CRIMP			
BNC3175-L400			

SCALE	ASSEMBLY REV.	CONNECTOR REV.	UNIT	MM
3 / 1	-	-		

DIMENSION ALL MILLIMETERS UNLESS OTHERWISE SPECIFIED TOLERANCES (UNIT: MM)	DATE
0.5~ 5= ±0.05	
5~10 = ±0.07	
10~20 = ±0.10	
20~30 = ±0.15	
30~ = ±0.20	

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

BNC3175-L400		DATE	2015/12/04	REV	—
A		B		C	
					
BODY		CONTACT PIN		FERRULE	
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y ". (USE SQUARE 1.6mm/0.063inch SECTION OF INSERT-C)		
			Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.		
			Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 10.7mm/0.421inch HEX SECTION OF INSERT-C)		
This part number complies with RoHS. Notice: JYEBao reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	