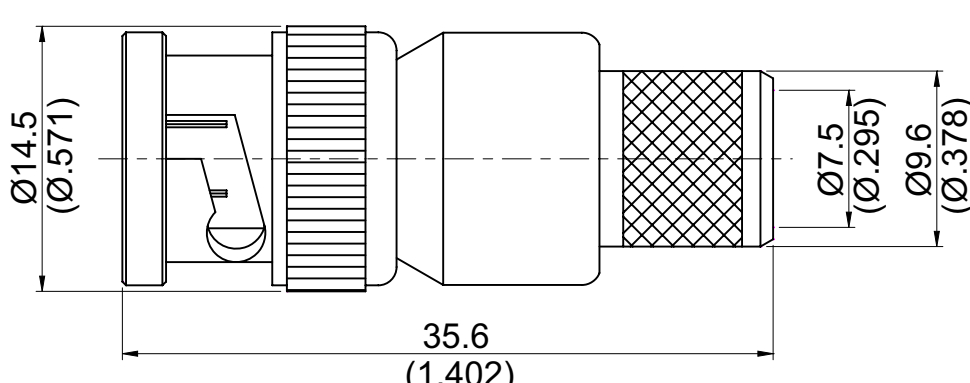


BNC3100-R011	BNC Jack Crimp	75Ω																														
																																
NOTE: Crimped center contact.																																
<table><tr><th>Parts</th></tr><tr><td>Ferrule</td></tr><tr><td>Gasket</td></tr><tr><td>Washer</td></tr><tr><td>Spring</td></tr><tr><td>Contact Pin</td></tr><tr><td>Barrel</td></tr><tr><td>Insulator</td></tr><tr><td>Body</td></tr><tr><td>Coupling Nut</td></tr></table>	Parts	Ferrule	Gasket	Washer	Spring	Contact Pin	Barrel	Insulator	Body	Coupling Nut	<table><tr><th>Material</th></tr><tr><td>Brass</td></tr><tr><td>Silicon</td></tr><tr><td>Brass</td></tr><tr><td>SK5</td></tr><tr><td>Brass</td></tr><tr><td>Brass</td></tr><tr><td>Teflon</td></tr><tr><td>Brass</td></tr><tr><td>Brass</td></tr></table>	Material	Brass	Silicon	Brass	SK5	Brass	Brass	Teflon	Brass	Brass	<table><tr><th>Plating (Micro-inch)</th></tr><tr><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td></td></tr><tr><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20</td></tr><tr><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td></td></tr><tr><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>	Plating (Micro-inch)	Tin-Zinc-Copper-Alloy 100 Over Copper 50		Tin-Zinc-Copper-Alloy 100 Over Copper 50	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20	Tin-Zinc-Copper-Alloy 100 Over Copper 50		Tin-Zinc-Copper-Alloy 100 Over Copper 50	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts																																
Ferrule																																
Gasket																																
Washer																																
Spring																																
Contact Pin																																
Barrel																																
Insulator																																
Body																																
Coupling Nut																																
Material																																
Brass																																
Silicon																																
Brass																																
SK5																																
Brass																																
Brass																																
Teflon																																
Brass																																
Brass																																
Plating (Micro-inch)																																
Tin-Zinc-Copper-Alloy 100 Over Copper 50																																
Tin-Zinc-Copper-Alloy 100 Over Copper 50																																
Tin-Zinc-Copper-Alloy 100 Over Copper 50																																
Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20																																
Tin-Zinc-Copper-Alloy 100 Over Copper 50																																
Tin-Zinc-Copper-Alloy 100 Over Copper 50																																
Tin-Zinc-Copper-Alloy 100 Over Copper 50																																
Weight: Suitable Cables:RG11																																


This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.


CABLE ASSEMBLY INSTRUCTION

BNC3100-R011

JYE BAO CO., LTD.

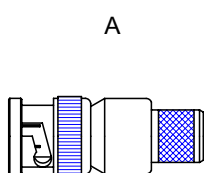

BODY

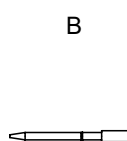


CONTACT PIN




FERRULE

DIAGRAM


ASSEMBLY INSTRUCTION

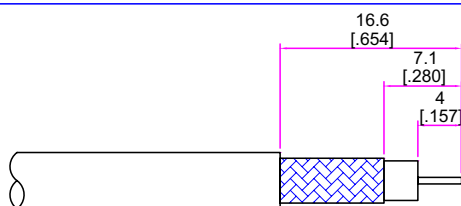


Step 1: STRIP AS SHOWN .

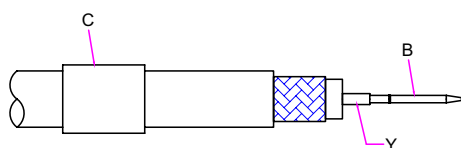

Step 2: SLIDE FERRULE " C " OVER CABLE.
Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND CRIMP IN " Y " .

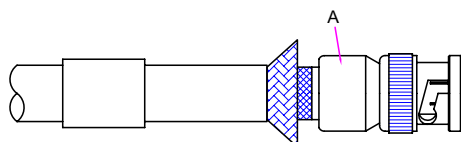

Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.

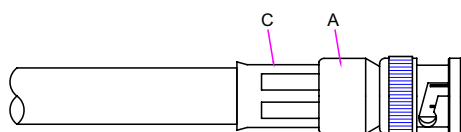

Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.