



## SMA8105-0058


## **SMA Jack Crimp For Bulkhead**

50Ω

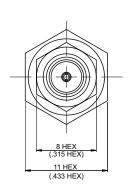

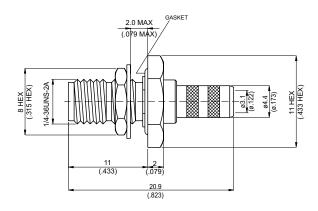

## MOUNTING HOLE:

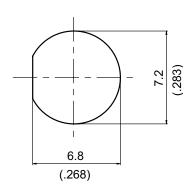

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Hex Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50
Lock Washer	Brass	Gold 5 Over Nickel 50 Over Copper 50
Gasket	Silicon	
Contact Pin	Beryllium Copper	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight: 5.06 g

Suitable Cables: RG58, JBY195

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## CABLE ASSEMBLY INSTRUCTION SMA8105-0058 JYE BAO CO., LTD. Α С 0 **FERRULE CONTACT PIN BODY** +HEX NUT+GASKET **+LOCK WASHER** ASSEMBLY INSTRUCTION DIAGRAM 15.0 [.590] Step 1: STRIP AS SHOWN. 2.5 [.098] В Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y". С Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "C" IN PLACE. Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "C" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.